


SEND THE "COMPLETE" PART

ONLY!

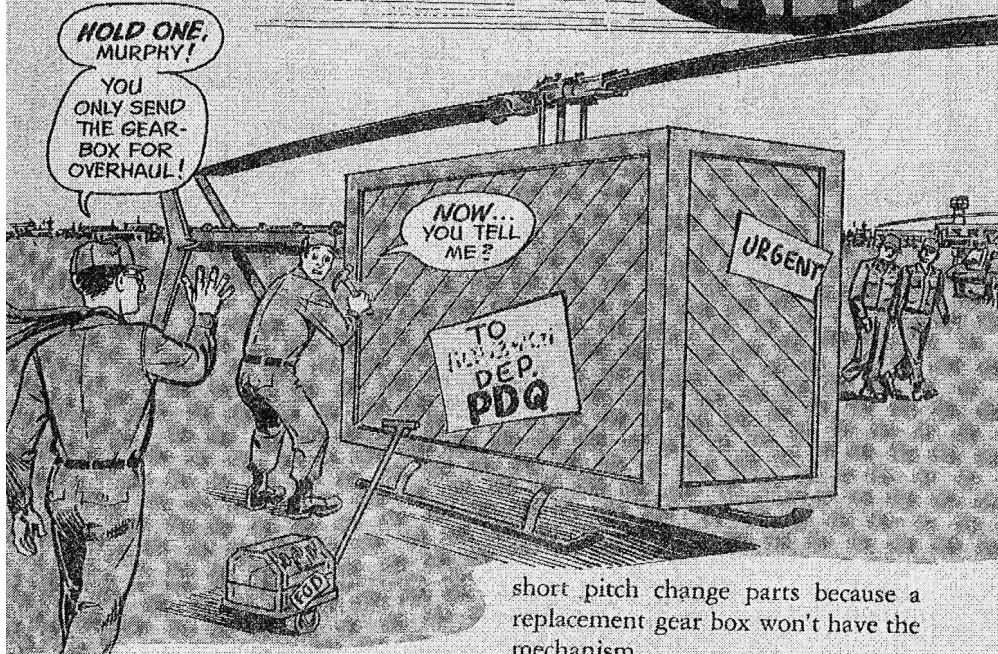

Some Kiowa tail rotor gear boxes arrive at overhaul with extra parts—some with not enough parts.

The pitch change mechanism, for one, has been shipped with the gear box. This means a unit will end up

short pitch change parts because a replacement gear box won't have the mechanism.

For another, gear boxes have arrived without the chip detector bayonet. Now, any on-the-stick mech knows that the female and male just naturally go together!

Without the male bayonet, extra ones have to be bought by support so that a complete gear box can be sent back to the field.

Sure, it may take a little more time to disconnect the chip detector at the outboard end of the bayonet. But you'll hold down the tab for replacement parts.

The Kiowa parts pub clues you on what parts are included in a complete tail rotor gear box assembly.

