


## IMPROVED BEARING

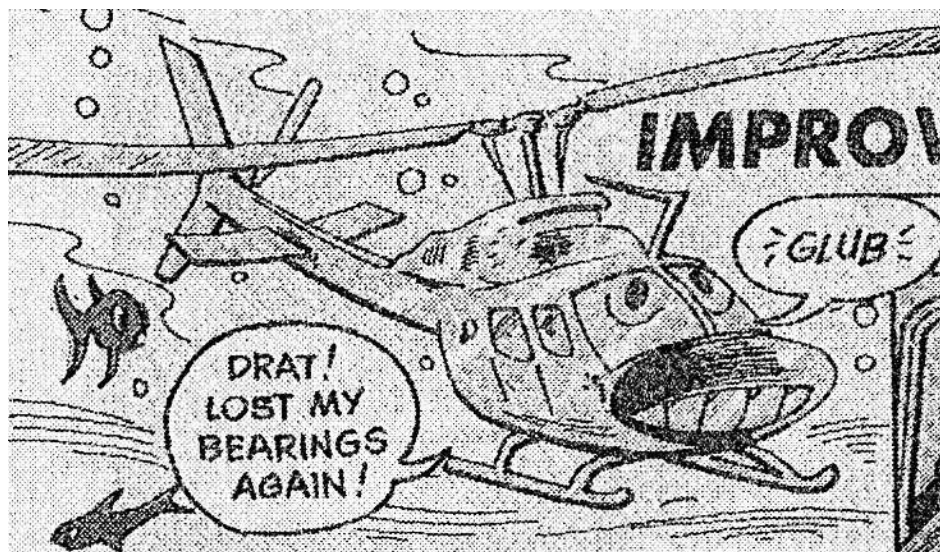

Keeping the tail rotor drive shaft bearings on your Kiowa (OH-58A) lubed is a chore you can soon forget.

Put in the new-type bearings with an improved lubricant and better seal . . . FSN 3110-106-8664.

From then on, eyeball the bearing every 50 hours to make sure it's in operating condition. You never have to lube the new bearing. Just replace it every 600 hours.

