


## How's Your Wiring?

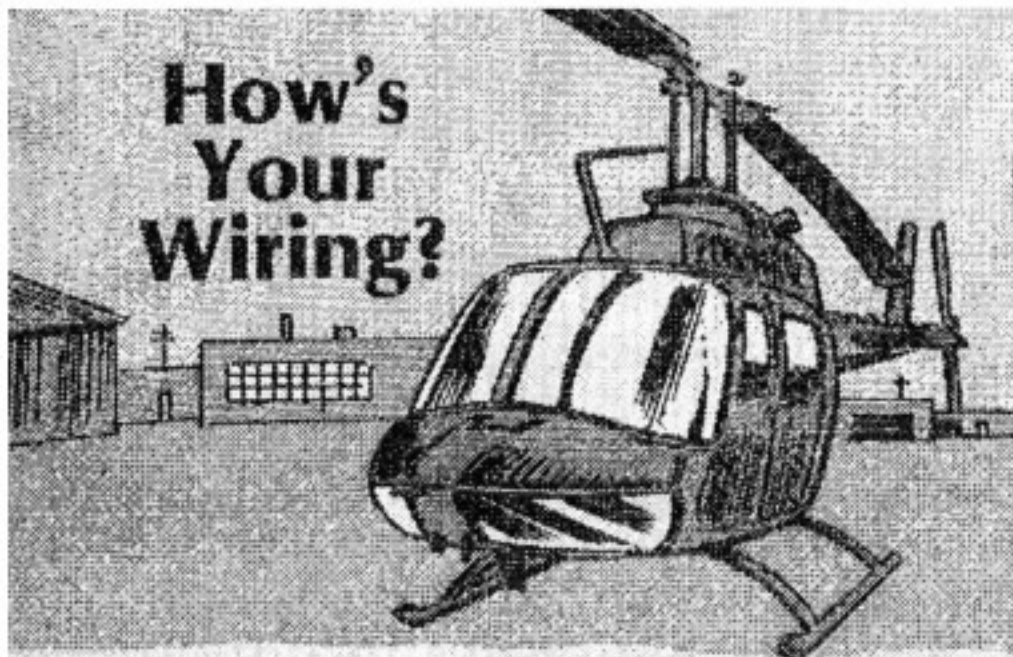

Do you Kiowa types have an OH-58A with a serial number prior to 72-21261? If so, check the landing light's wiring.

The early models had low-temperature wiring that has not been replaced. During night operations, the wires heat up and burn. You need high-temperature wiring, according to the note on Page 9-58, TM 55-1520-228-23.

If the lamp is burned out, get a new one with NSN 6240-00-577-8450.

HERE'S WHAT YOU NEED TO REWIRE THE OH-58A LANDING LIGHT!



Item	Quantity
12-gage wire power lead, NSN 6145-00-056-8451	1 ft
16-gage ground wire, NSN 6145-00-056-8484	2 ft
16-gage terminal lugs, NSN 5940-00-143-4780	2 ea
12-gage terminal lugs, NSN 5940-00-143-4775	4 ea

